


平成22年4月～平成23年3月 BOD平均値 (mg/リットル)

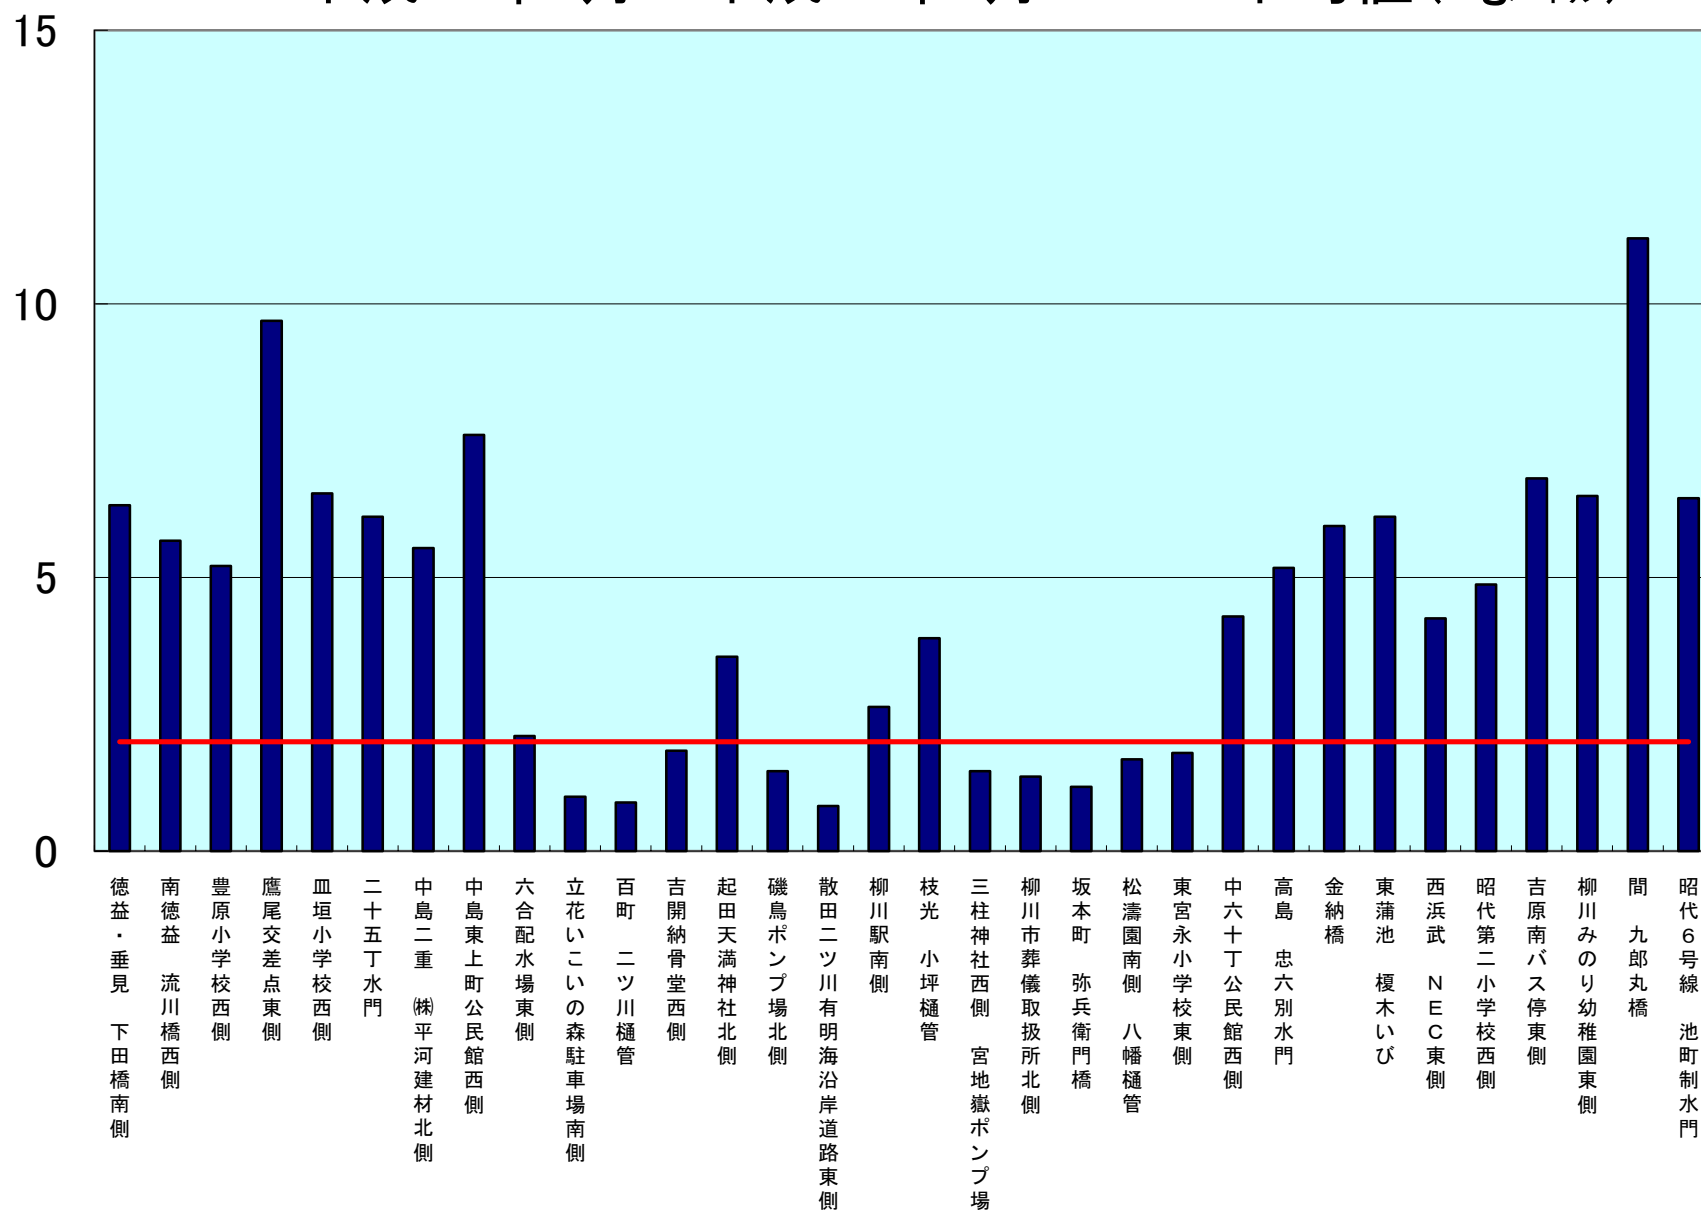

【参考】
環境基準(河川)
A類型: 2mg/リットル

採水基準日	H22 4/1	4/16	5/6	5/17	6/1	6/16	7/1	7/16	8/2	8/16	9/1	9/16	10/ 1	10/18	11/1	11/16	12/1	12/16	H23 1/6	1/17	2/1	2/16	3/1	3/16	平均値
1 徳益・垂見 下田橋南側	4.1	3.1	3.5	6.0	6.9	27.7	6.4	17.4	2.1	4.4	6.9	1.8	6.3	4.6	4.6	10.7	3.8	2.2	6.7	2.6	4.4	3.0	4.8	7.7	6.3
2 南徳益 流川橋西側	1.4	6.0	0.9	2.0	3.8	9.0	4.2	10.9	1.4	11.9	2.6	11.6	5.8	12.4	3.1	5.2	2.4	6.8	4.4	16.5	2.6	3.3	5.8	2.1	5.7
3 豊原小学校西側	4.7	8.2	4.3	5.9	5.0	2.7	9.0	10.7	0.9	2.6	5.0	7.5	3.5	6.5	3.7	4.6	3.5	3.4	6.3	3.4	4.6	2.5	3.3	13.3	5.2
4 鷹尾交差点東側	20.1	8.2	4.7	15.0	19.4	8.9	18.3	23.5	2.9	4.7	5.8	5.0	7.7	12.7	10.5	12.7	14.6	8.5	5.0	2.2	5.4	2.7	5.9	8.2	9.7
5 皿垣小学校西側	4.1	2.5	6.5	3.4	7.1	15.6	20.1	18.2	1.7	4.3	3.0	1.7	7.7	5.6	4.4	6.1	7.7	2.5	2.5	10.1	1.4	6.4	7.3	6.9	6.5
6 二十五丁水門	6.4	7.1	6.8	3.4	9.3	6.3	15.3	20.7	1.7	5.1	3.8	3.7	4.8	5.5	5.6	8.9	4.6	2.9	4.1	4.2	2.5	6.0	5.0	2.9	6.1
7 中島二重 榑平河建材北側	19.9	5.0	12.9	9.4	9.4	0.9	0.8	0.7	11.1	3.1	7.8	1.3	5.6	5.2	13.7	2.6	2.4	6.7	2.5	0.7	0.7	2.7	4.7	3.1	5.5
8 中島東上町公民館西側	2.9	9.4	26.7	13.3	24.8	0.9	6.4	1.8	8.8	24.6	3.9	12.0	12.6	3.0	2.9	8.5	2.4	3.1	4.6	0.7	0.8	1.6	2.0	4.8	7.6
9 六合配水場東側	0.9	3.0	1.0	0.8	0.7	3.7	6.1	5.6	2.0	1.7	0.8	0.7	0.7	2.5	3.9	5.4	2.7	1.7	0.7	0.7	0.8	1.4	2.0	0.9	2.1
10 立花いこいの森駐車場南側	3.3	1.0	0.7	0.7	0.7	0.8	0.7	0.7	0.7	0.7	0.7	0.7	0.7	0.7	2.1	1.3	1.0	0.9	1.7	0.7	0.7	1.0	0.9	0.7	1.0
11 百町 ニツ川樋管	0.8	0.7	0.7	0.7	0.7	1.3	0.7	1.7	0.7	0.7	0.7	0.7	0.7	0.7	2.5	1.0	0.7	0.7	0.7	0.7	0.7	1.3	0.8	0.7	0.9
12 吉開納骨堂西側	1.3	0.9	14.4	1.2	0.7	1.4	1.8	2.9	0.7	0.7	0.7	0.7	0.7	0.7	1.8	3.8	2.5	2.2	0.8	0.7	0.7	0.7	1.3	0.7	1.8
13 起田天満神社北側	3.3	3.0	5.4	4.4	6.1	3.4	3.1	7.8	10.1	1.6	2.4	1.2	0.9	2.9	5.1	9.5	3.4	2.5	1.6	3.3	1.0	1.0	1.2	1.0	3.6
14 磯鳥ポンプ場北側	0.9	0.8	0.9	0.7	1.2	1.8	0.9	3.8	0.7	0.7	0.8	1.4	1.3	0.8	1.7	4.6	2.6	1.4	0.8	0.7	0.7	0.7	0.8	4.3	1.5
15 散田ニツ川有明海沿岸道路東側	0.8	0.7	1.7	0.7	0.7	1.2	0.7	1.2	0.7	0.7	0.7	0.7	0.7	0.7	1.2	0.9	0.8	0.7	0.7	0.7	0.7	0.7	0.7	0.7	0.8
16 柳川駅南側	5.9	1.2	3.1	3.1	3.0	1.7	8.0	9.9	2.1	0.7	2.4	1.2	1.7	0.7	4.3	7.6	0.9	0.9	0.9	0.7	0.7	0.7	0.8	1.0	2.6
17 枝光 小坪樋管	8.9	5.4	2.6	1.8	6.1	3.3	6.3	10.2	0.8	0.8	2.0	1.3	2.2	2.1	2.1	6.0	2.2	3.0	2.0	3.0	2.6	3.7	4.3	10.7	3.9
18 三柱神社西側 宮地嶽ポンプ場	1.2	0.7	1.7	0.7	0.7	2.1	3.3	1.8	0.7	0.9	1.2	0.7	2.0	0.7	1.0	3.0	4.7	0.7	0.7	0.7	0.7	2.9	1.0	1.3	1.5
19 柳川市葬儀取扱所北側	2.1	0.9	1.2	0.7	1.2	2.4	1.3	3.0	0.7	0.9	0.8	1.2	1.3	0.8	0.7	1.2	4.2	0.8	0.7	0.7	0.7	1.2	3.3	0.7	1.4
20 坂本町 弥兵衛門橋	1.2	0.8	0.8	0.7	0.7	1.8	0.9	3.0	0.7	0.7	1.0	1.3	2.0	1.3	1.3	3.1	1.4	0.7	0.7	0.7	0.7	0.7	0.7	1.3	1.2
21 松濤園南側 八幡樋管	2.7	0.8	1.7	0.7	1.0	2.0	1.8	5.9	2.1	0.7	2.6	1.2	2.4	1.8	1.0	2.2	2.4	1.6	0.8	0.7	0.7	0.7	0.9	1.8	1.7
22 東宮永小学校東側	1.8	5.4	1.4	0.7	0.7	1.7	3.5	6.9	0.8	1.4	0.8	0.8	3.4	3.4	2.1	1.8	1.0	0.8	0.7	1.2	0.7	0.7	0.7	0.7	1.8
23 中六十丁公民館西側	1.8	4.4	3.5	3.9	3.0	1.3	28.5	16.7	2.7	3.4	4.8	1.4	2.5	1.8	2.4	6.4	1.8	2.2	1.6	0.7	0.7	0.7	0.9	5.8	4.3
24 高島 忠六別水門	12.9	4.3	9.9	8.8	2.5	5.2	11.2	17.0	3.7	4.2	1.8	2.2	3.0	4.3	2.6	6.5	3.1	6.5	2.9	1.6	1.2	2.0	2.0	4.8	5.2
25 金納橋	5.0	8.0	4.8	2.5	6.1	2.9	17.7	19.9	2.9	3.8	2.5	2.7	2.4	4.4	2.6	6.9	8.2	10.5	3.3	2.6	3.4	5.4	8.6	5.5	5.9
26 東蒲池 榎木いび	10.1	8.1	6.7	4.4	3.8	6.4	15.8	24.1	1.2	2.9	3.5	2.6	3.9	4.3	10.1	8.1	4.3	5.5	4.4	1.8	2.5	1.0	3.3	7.8	6.1
27 西浜武 NEC東側	7.6	7.2	2.4	4.2	3.5	2.2	9.5	11.6	1.3	2.1	2.2	2.0	2.5	1.6	2.5	9.3	7.2	6.9	3.8	0.8	1.2	0.8	2.0	7.7	4.3
28 昭代第二小学校西側	4.1	8.1	4.2	4.8	4.3	4.7	10.6	10.9	2.4	2.5	3.4	2.4	3.1	2.5	2.6	10.9	8.1	6.5	4.2	1.0	1.0	1.8	1.3	11.5	4.9
29 吉原南バス停東側	33.0	7.2	4.4	7.6	3.9	3.8	17.0	10.2	3.9	1.2	3.4	2.5	2.0	4.7	4.1	11.1	7.6	5.9	3.5	1.4	2.7	3.1	5.5	13.7	6.8
30 柳川みのり幼稚園東側	16.1	11.9	6.1	12.6	7.3	4.8	7.8	12.0	4.4	2.9	1.4	3.1	3.9	3.8	4.3	13.9	6.7	6.9	6.1	1.0	2.0	3.4	4.8	8.6	6.5
31 間 九郎丸橋	24.1	14.9	12.4	12.8	17.0	6.1	13.6	15.4	4.1	2.4	4.4	2.2	3.9	7.5	5.0	13.3	8.8	12.8	9.0	10.6	4.2	4.8	21.7	37.7	11.2
32 昭代6号線 池町制水門	10.6	5.6	3.8	9.3	4.4	4.3	25.1	14.0	4.1	1.3	3.5	1.2	6.1	4.3	6.4	11.1	5.2	5.6	6.3	2.0	3.4	2.7	5.1	9.3	6.4
平均	7.0	4.8	5.1	4.6	5.2	4.4	8.6	10.0	2.7	3.1	2.7	2.5	3.4	3.6	3.8	6.5	4.2	3.9	3.0	2.5	1.8	2.2	3.5	5.9	4.4